


## UNCONTROLLED DOCUMENT



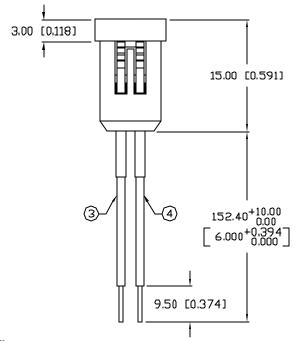

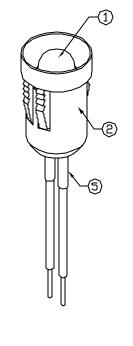

## NOTES:

- 1. SSL-LX5093ID LED, CUT LEADS TO 4mm.
- 2. SSH-RTF5020 HOLDER.
- 3. ANODE LEAD: LXP-WST24RDTOC CUT 160 LONG, STRIP 3mm & 9.5mm.
- 4. CATHODE LEAD: LXP-WST24BLTOC CUT 160 LONG, STRIP 3mm & 9.5mm.
- 5. LXP-HEATSHRINK-2, (2 PCS.) 1/16" x 1/2" LONG.

PANEL CUTOUT: 8.05mm PANEL THICKNESS: D.6~2.8mm

PART NUMBER SSI-LXR5020ID-150 REV.

REV.	E.C.N. NUMBER AND REVISION COMMENTS	DATE
Α	E.C.N. #10BRDR, & REDRAWN.	6.10.99
В	E.C.N. #10BRDR, & REDRAWN,	8.30.01

ELECTRO-OPTICAL CHARACTERISTICS TA=25°C If=20mA							
PARAMETER	MIN	TYP	MAX	UNITS	TEST COND		
PEAK WAVELENGTH		635		nm			
FORWARD VOLTAGE		2.0	2.5	٧f			
REVERSE VOLTAGE	5.0			٧r	I <sub>r</sub> = 1 00µA		
AXIAL INTENSITY		40		mcd	$I_f = 20mA$		
VIEWING ANGLE		<del>6</del> 0		2x theta			
EMITTED COLOR:	RED						
EPOXY LENS FINISH:	RED DIF	FUSED					

## LIMITS OF SAFE OPERATION AT 25°C

PARAMETER	MAX	UNITS
PEAK FORWARD CURRENT*	150	mA
STEADY CURRENT	30	mA
POWER DISSIPATION	105	mW
DERATE FROM 25°C	- 1.2	mW/°C
OPERATING, STORAGE TEMP.	- 40 TO +85	·c
SOLDERING TEMP.	+ 260	°C
2.0mm FROM BODY		3 SEC. MAX

\* t<10µS

CAUTION: PRESSURE SENSITIVE ASSEMBLY AVOID APPLYING PRESSURE TO LED DURING PANEL ASSEMBLY.

UNCONTROLLED DOCUMENT \*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECINAL PRECISION ARE: X=±1 (±0.039), XX=±0.5 (±0.020), XXX=±0.25 (±0.0010), XXXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030). MIN= +DECINAL PRECISION MAX.= +0.00 (±0.002), XXX=±0.127 (±0.005).

REV. PART NUMBER SSI-LXR5020ID-150

T-5mm (T-1 3/4) ROUND PANEL INDICATOR LED. 635nm HIGH INTENSITY RED LED, RED DIFFUSED LENS, WITH 6" WIRE LEADS.

CONFIDENTIAL INFORMATION
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF
LUMEX NO. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX
INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION
CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD PALATINE, IL 60067-6976 PHONE: +1.847.359.2790

BIA

US WEB: www.lumex.com TW WEB: www.lumex.com.tw

CHECKED BY: DRAWN BY: APPROVED BY: DATE: 7.17.95 PAGE: 1 OF 1 SCALE: N/A CT