


301 00 849

TERMINAL - MALE

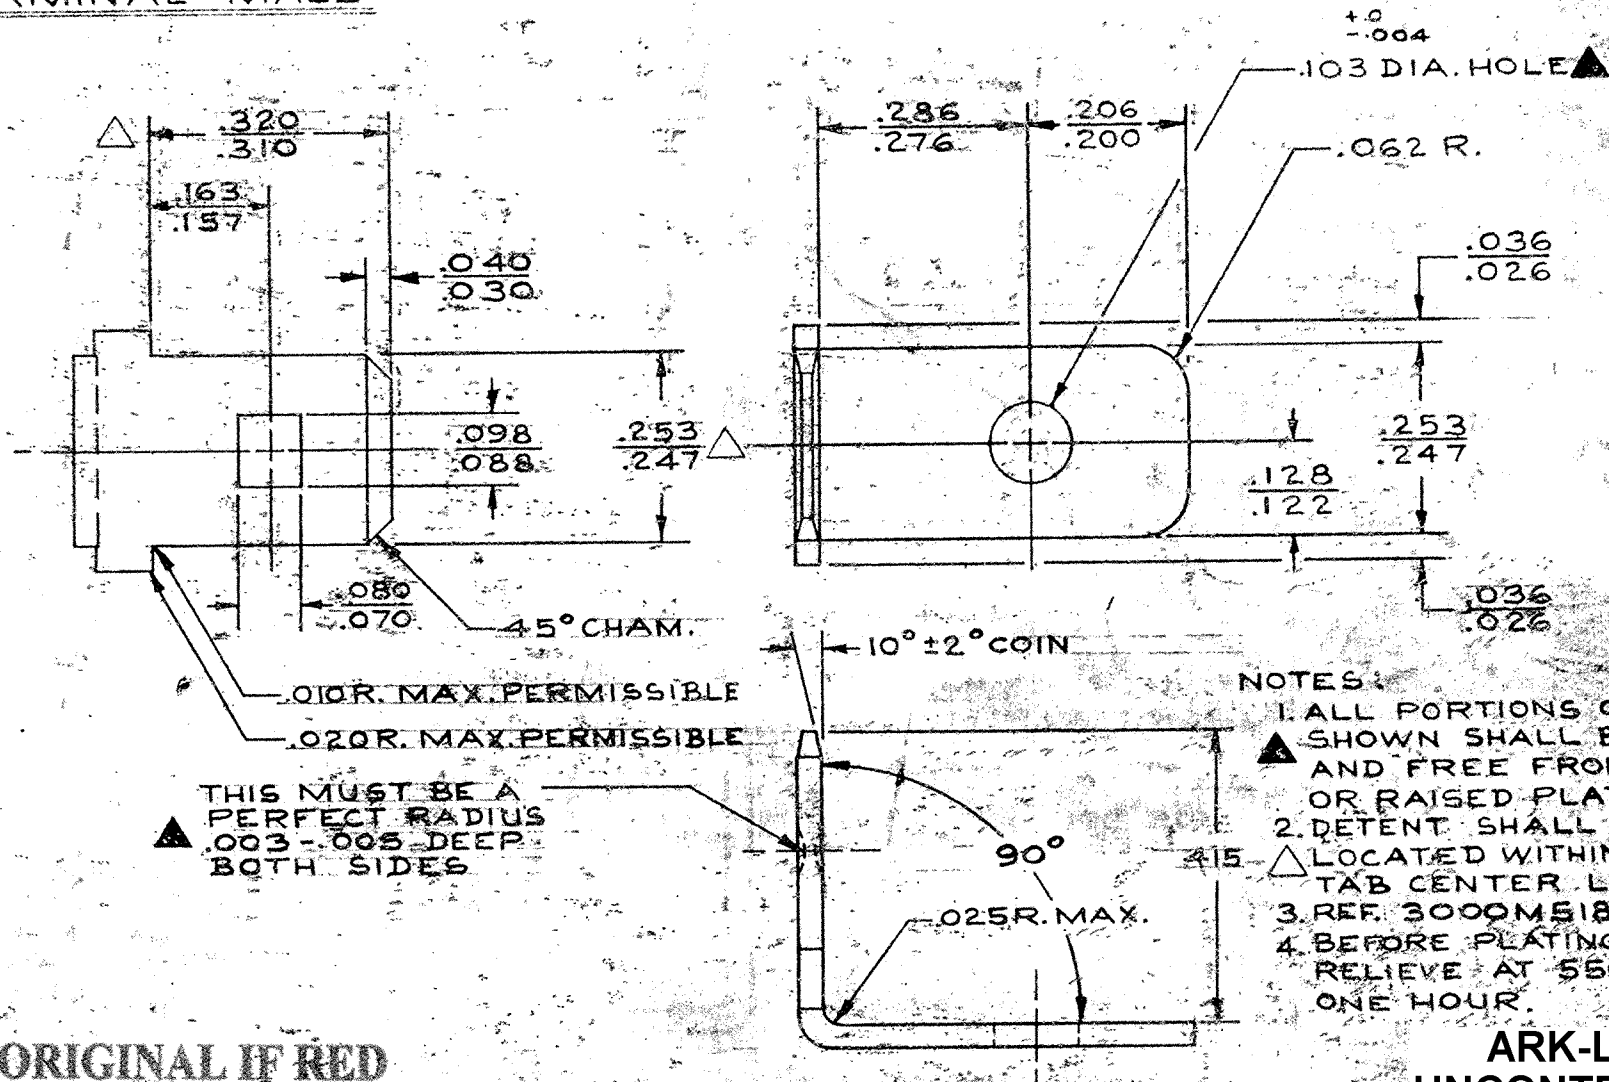

NOTES:

1. ALL PORTIONS OF TABS SHOWN SHALL BE FLAT AND FREE FROM BURRS OR RAISED PLATEAUS.
2. DETENT SHALL BE LOCATED WITHIN .005 OF TAB CENTER LINE.
3. REF. 3000M518 TOOLS.
4. BEFORE PLATING STRESS RELIEVE AT 550°F FOR ONE HOUR.

**ARK-LES
UNCONTROLLED**

ORIGINAL IF RED

RELEASED FOR PRODUCTION	69839	10-17-62	H. K.	TOLERANCES UNLESS OTHERWISE SPECIFIED:		
RELEASED FOR TOOLS	69839	10-17-62	H. K.	DECIMALS $\pm .005$	FRACTIONS $\pm .010$	ANGLES $\pm 1^\circ$
RELEASED FOR QUOTATION	69839	10-17-62	H. K.	.010		
NEW DRAWING SUPERSEDES				DO NOT SCALE DRAWING		
DRAWN BY H. K.	MATERIAL .032 $\pm$.001 H. K. BRASS, CA 220					
CHECKED BY ARF	R 307 56.5-68 (B)					
APPROVED BY ARF	FINISH SILVER FLASH 0.00081 MIN. THICKNESS (A)					

DATE OF DRAWING OCT. 17, 1962

SCALE 4 TO 1

DATE OF PRINT